


---

Alert number	<u>SR/01911/25</u>
--------------	--------------------

---

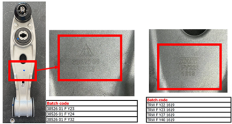

Notifying country	Germany
-------------------	---------

Product category	Motor vehicles
------------------	----------------

Type	Consumer
------	----------

Product	Vehicle part / Control arm
---------	----------------------------

Name	LEMFÖRDER: 38526 01; TRW: JTC1619
------	-----------------------------------

Brand	ZF Friedrichshafen AG
-------	-----------------------

Production dates	07.06.2024 - 05.03.2025
------------------	-------------------------

Product description	Vehicle part: track control arm.
---------------------	----------------------------------

Risk type	Injuries
-----------	----------

Risk description	Due to a production error, the connector inner sleeve of the recalled control arms, when fitted, may leave a gap which could permit further compression of the component during tightening. This can lead to stress in the subframe and cause cracking. A crack or microcrack in the subframe can result in damage to the front axle beam, which can impair driving and increase the risk of an accident and injury.
------------------	--

Legal provisions (at EU level) and European standards against which the product was tested and did not comply	The product does not comply with the Regulation on the approval and market surveillance of motor vehicles and their trailers, and of systems, components and separate technical units intended for such vehicles.
---	---

Country of origin      Malaysia

Measures taken by  
economic operators      Recall of the product from end users  
Manufacturer